


## American Fuses Welder Protectors A4BX

### WELDER PROTECTORS

Ferraz Shawmut Welder Protectors are special purpose limiters used to provide isolation of faulted welding equipment and protection for the cable drop supplying the welder. Welder Protectors have a high thermal capacity and are less affected by high ambient temperatures and extended weld times than similar size Class J or K fuses\*. Welder Protectors should only be applied for isolation of short circuited welding circuits. Overload protection must be provided for by other means.

\* Contact us for Class L sizes and rating

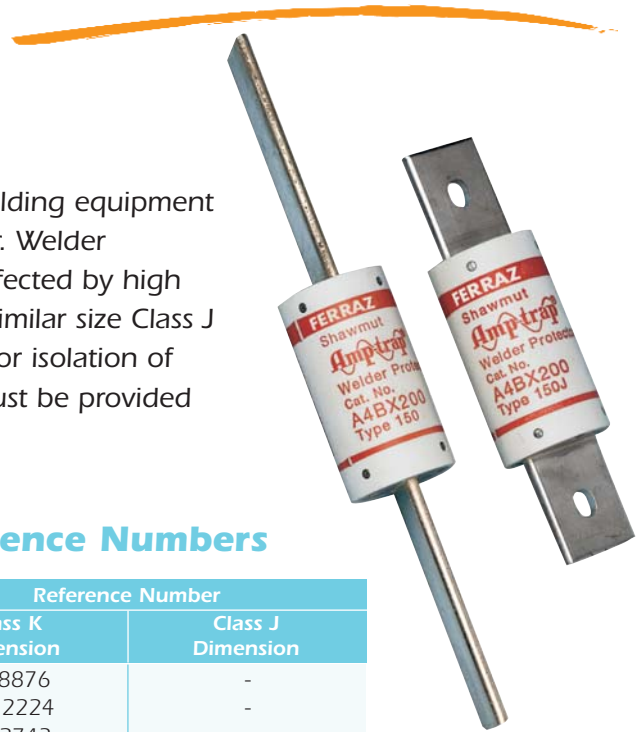

### Standard Fuse Ampere Ratings, Reference Numbers



Ampere Rating	Catalog Number		Reference Number	
	Class K Dimension	Class J Dimension	Class K Dimension	Class J Dimension
100	A4BX100-150	-	J218876	-
125	A4BX125-150	-	D212224	-
150	A4BX150-150	-	S212743	-
200	A4BX200-150	A4BX200-150J	H217334	M217844
225	A4BX225-150	-	G211192	-
300	A4BX300-150	A4BX300-150J	J215288	K215795
400	A4BX400-150	A4BX400-150J	N217845	Y218360
500	A4BX500-150	-	M222605	-
600	A4BX600-150	-	F201968	-

### Ratings

- 600VAC, 200kA I.R.

### Approvals

- Ferraz Shawmut Certified

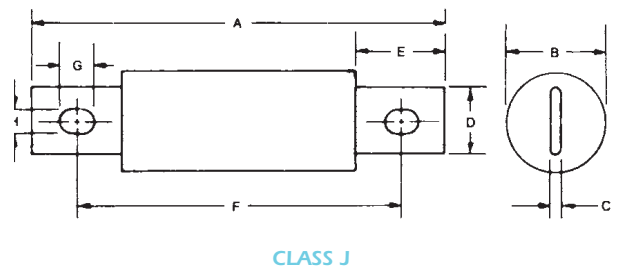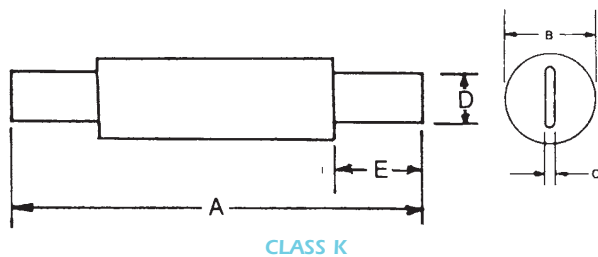

### A4BX ( ) - 150; Class K Dimensions

Ampere Rating	Inches							
	A	B	C	D	E	F	G	H
100	7-7/8	1	1/8	23/32	2-5/8	-	-	-
125-200	9-5/8	1-1/2	3/16	1-1/8	3-7/16	-	-	-
225-400	11-5/8	2	1/4	1-5/8	4-7/16	-	-	-
500-600	13-3/8	2-1/2	1/4	2	5-5/16	-	-	-


### A4BX ( ) - 150J; Class J Dimensions

125-200	5-3/4	1-1/2	3/16	1-1/8	1-1/2	4-3/8	3/8	9/32
225-400	7-1/8	2	1/4	1-5/8	2-3/16	5-1/4	17/32	13/32

# Special Purpose Fuses

## American Fuses Welder Protectors A4BX

### A4BX100 to 600 Types 150, 150J

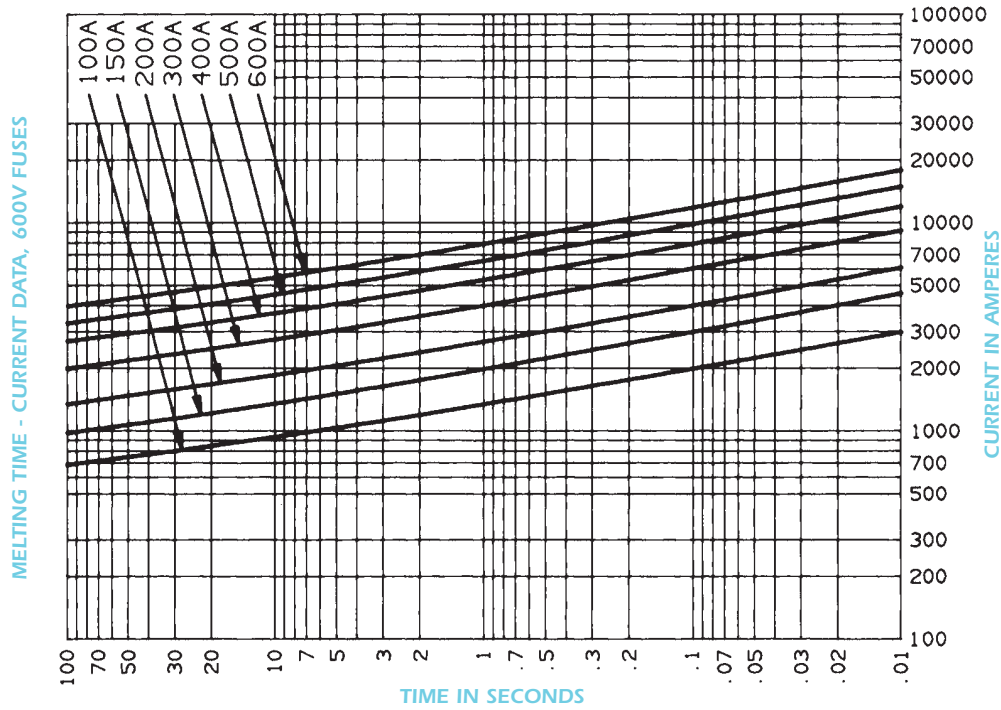

### Peak Let-Thru Current Data - A4BX100 to 600, 600 Volts AC

